

# Manhole Inspection Summary

Manhole # S31GG2014MH

Printed On: 12/17/2008

Page 1 of 3

**Inspection** ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **31GG2** Node: **014** Status: **Found**

Insp Date: **12/21/06 10:29 AM**

Incomplete Comments

Crew: **JY, JJ**  
Inspector: **Jensen, J**  
Firm: **RKK**

**Location** Address: **101 FIRESIDE CIR**

Cross Street: **LAKE AVE**

**Manhole** Type: **Inline** Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry**

Subject To Ponding: **None**

Comments

**Cover** Shape: **Circular** Diameter: **30** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **0** (in.) Condition: ☐ Sound ☐ Cracked ☒ **Leaks**

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick** ☐ Parged Height: **16** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

**Corbel** Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

**Barrel** Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **42** (in.) Length: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

**Bench** ☒ Exists Material: **Brick** ☐ Parged ☒ **Debris** (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Brick** ☐ Parged ☐ Debris (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Deteriorated** ☐ Leaks ☒ **Debris**

**Steps** Count: **5** Missing: **0** ☐ Corroded

**Surcharge** ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S31GG2014MH

Printed On: 12/17/2008

Page 2 of 3

Location View



Top View




Bench and Channel debris.

Defect



Barrel deterioration and infiltration. Bench debris

Defect

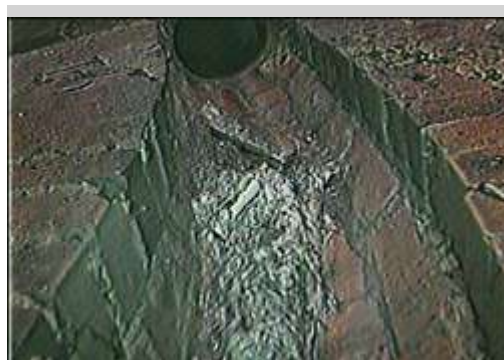

Channel deterioration and debris.

Defect



Frame leaks. Adjustment deterioration and infiltration. Corbel and Barrel infiltration - other side.

Defect



Frame leaks. Adjustment, Corbel and Barrel infiltration.

## Manhole Inspection Summary

Manhole # S31GG2014MH

Printed On: 12/17/2008

Page 3 of 3

### 8 in. Circular Gravity Sewer

Pipe Out @ 12 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.63** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☒ **Mud** ☐ Sludge ☒ **Debris** ☒ **Grease**

Silt Depth: **0.5** (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

### 8 in. Circular Gravity Sewer

Pipe In @ 5 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.82** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ **None** ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection